

sanwa®

MG601
MG601-M

デジタル絶縁抵抗計

DIGITAL INSULATION RESISTANCE TESTER

取扱説明書
INSTRUCTION MANUAL

CE

目 次



[1]	安全に関する項目～ご使用の前に必ずお読みください。～	
1-1	警告マークなどの記号説明	1
1-2	安全使用のための警告文	1
1-3	過負荷保護入力値	2
[2]	用途と特長	
2-1	用途	3
2-2	特長	3
[3]	各部の名称	
3-1	本体・テストリード	4
3-2	表示器	5
[4]	機能説明 (MG601、MG601-M共通)	
4-1	テストリード固定機能	6
4-2	電源ボタン：⏻	6
4-3	電圧測定機能：AUTOV ボタン	6
4-4	抵抗測定機能：Ω ボタン	6
4-5	導通チェック機能：● ボタン	6
4-6	周波数測定機能：Hz ボタン	7
4-7	直流電圧 (DCmV) 測定 兼 速度表示機能：DCmV ボタン	7
4-8	テスト電圧選択機能：15 V/500 V ボタン	7
4-9	絶縁抵抗測定機能：TEST MΩ ボタン	7
4-10	データホールド機能：HOLD ボタン	8
4-11	バックライト機能：☀ ボタン	8
4-12	オートパワーオフ機能	8
4-13	電池消耗警告表示	8
4-14	電圧警告表示・ブザー	9
4-15	ディスプレイチャージ (放電) 機能	9
4-16	ブザー解除機能	10
[5]	測定方法	
5-1	始業点検	11
5-2	電圧測定 (AUTOV)	13
5-3	周波数測定 (Hz)	14
5-4	抵抗測定 (Ω)	15
5-5	導通チェック (●)	16
5-6	直流電圧 (DCmV) 測定 兼 速度表示機能	17
5-7	絶縁抵抗測定	18
[6]	保守管理について	
6-1	保守点検	21
6-2	校正	21
6-3	清掃と保管について	21
6-4	電池交換	22
[7]	アフターサービスについて	
7-1	保証期間について	23
7-2	修理について	23
7-3	お問い合わせ	24
[8]	仕様 (MG601、MG601-M共通)	
8-1	一般仕様	24
8-2	別売品	25
8-3	測定範囲および精度	25
保 証 書		最終ページにあります

【1】安全に関する項目～ご使用前に必ずお読みください。～

このたびは、デジタル絶縁抵抗計 MG601、MG601-Mをお買い上げいただき、誠にありがとうございます。

ご使用前にはこの取扱説明書をよくお読みいただき、正しく安全にご使用ください。そして常にご覧いただけるように製品と一緒に大切に保管してください。

本書で指定していない方法で使用すると、本製品の保護機能が損なわれることがあります。

本文中の“警告”および“注意”の記載事項は、“やけど”や“感電”などの事故防止のため、必ずお守りください。

1-1 警告マークなどの記号説明


本器および『取扱説明書』に使用されている記号と意味について

：安全に使用するための特に重要な事項を示します。

- ・ 警告文は“やけど”や“感電”などの人身事故を防止するためのものです。
- ・ 注意文は本器を壊すおそれのあるお取り扱いについての注意文です。

本器の記号の説明：

：使用前に取扱説明書を参照してください。

：高電圧が印加されることがあり危険ですので触らないでください。

：二重絶縁または強化絶縁 ：グラウンド

：抵抗測定 ：導通チェック

：バックライト ：電源ボタン

：TEST MΩボタンロック位置

1-2 安全使用のための警告文

警 告

以下の項目は、“やけど”や“感電”などの人身事故を防止するためのものです。本器をご使用する際には必ずお守りください。

1. 本器は低電圧用の絶縁抵抗計です。600 Vを超える電路では使用しないこと。
2. 最大定格入力値 (1-3 参照) を超える信号は入力しないこと。
3. 最大過負荷入力値を超える恐れがあるため誘起電圧、サージ電圧の発生する (モータ等) ラインの測定はしないこと。

4. 本体またはテストリードが傷んでいたり、壊れていたりする場合は使用しないこと。
5. ケースまたは電池ふたを外した状態では使用しないこと。
6. 測定中はテストリードおよびアリゲータクリップのつばよりテストピン側を持たないこと。
7. 測定中は他の測定機能に切り換ええないこと。
8. 測定ごとに測定機能の確認を確実にこなうこと。
9. 本器または手が水などで濡れた状態での使用はしないこと。
10. 電池交換を除く修理・改造は行わないこと。
11. 始業点検および年1回以上の点検は必ずこなうこと。
12. 屋内で使用すること。
13. 危険な活電部が存在する設備では事故防止のため絶縁保護具を使用する必要があります。地域および国の安全基準に従うこと。
14. 本器の保護機能が損なわれることがあるので指定されている方法以外で使用しないこと。

— △ 注 意 —

1. トランスや大電流路など強磁界の発生している近く、無線機など電磁波の発生している近く、または帯電しているものの近くでは正常な測定ができない場合があります。
2. インバータ回路のような特殊な波形では、本器が誤動作や正常な測定が出来ない場合があります。

1-3 過負荷保護入力値

測定機能	測定端子	最大定格入力値	最大過負荷保護入力値
絶縁抵抗	LINE、 EARTH	—	DC/AC 660 V
AUTOV		DC/AC 600 V	
Ω		電圧入力禁止	
Hz		1999 Hz	
DCmV		DC 2000 mV	

【2】用途と特長

2-1 用途

本器はCAT.IV 300 V、CAT.III 600 V の範囲内の電線路と電気機器の絶縁抵抗測定用の直流絶縁抵抗計です。更に別売の速度計SE9100を接続することにより、速度に対応した出力電圧値を速度としてそのまま読み取ることもできるようになっております。

2-2 特長

- ・ IEC61010/IEC61557に準拠した安全設計。
- ・ ポケットサイズで、絶縁抵抗測定時は定格電流 1 mA 以上。
- ・ 絶縁抵抗測定終了後は測定値をオートホールド。
- ・ 大型で見やすいバックライト付き液晶表示器。
- ・ プレーカーカバーの穴から測定できるプレーカーピン付属。
- ・ ピンキャップホルダー付き。
- ・ テスト電圧が分かりやすいLED付きボタン。
- ・ オートパワーオフ (約15分) 機能付き。解除可。
- ・ オートディスチャージ (自動放電) 機能付き。
- ・ 別売速度計SE9100接続により、エレベータなどの昇降機やベルトコンベアなど被測定対象から離れた所での速度が測定できます。
- ・ 絶縁抵抗測定で**TEST MΩ**ボタンを押す前に測定対象にテストリードを当てたとき活線状態(10 V 以上)である場合には自動検出して電圧表示になり、テスト電圧を発生しません。

測定カテゴリ (過電圧カテゴリ)



CAT. II : コンセントに接続する電源コード付き機器の一次側電路。

CAT. III : 直接分電盤から電気を取り込む機器の一次側および分電盤からコンセントまでの電路。


CAT. IV : 引き込み線から分電盤までの電路。

[3] 各部の名称

3-1 本体・テストリード

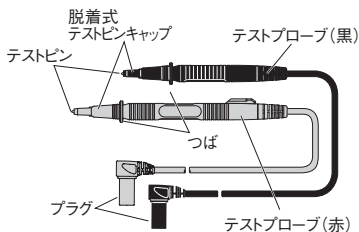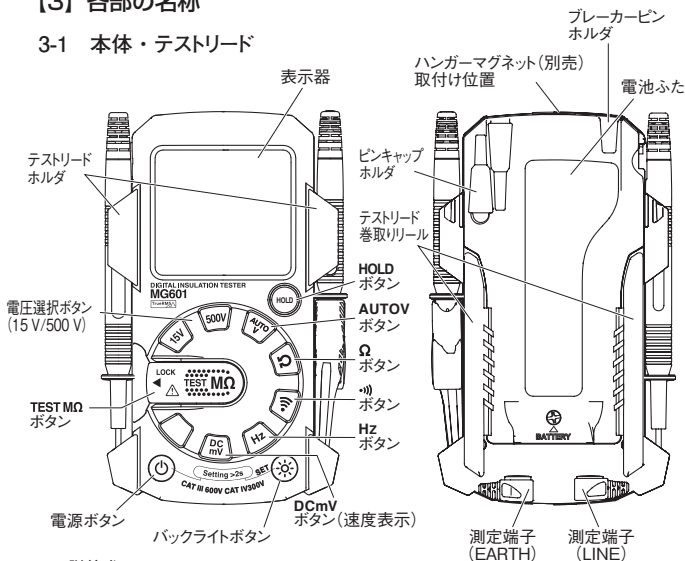

テストリード(赤・黒) ATL102

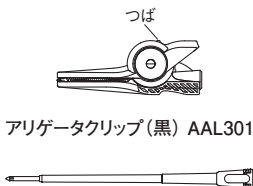


- ・着脱式テストピンキャップ装着時：
CAT.Ⅳ 300 V, CAT.Ⅲ 600 V
- ・着脱式テストピンキャップ未装着時：
CAT.Ⅱ 1000 V

- 備考：
- ・デジタル式絶縁抵抗計M53で使用する黒のクリップアダプタ：AAL302 (別売品)も使用可能※安全規格外

※テストリードは巻取りリールに巻いた状態で使用可能です。適度な長さにして使用してください。

3-2 表示器

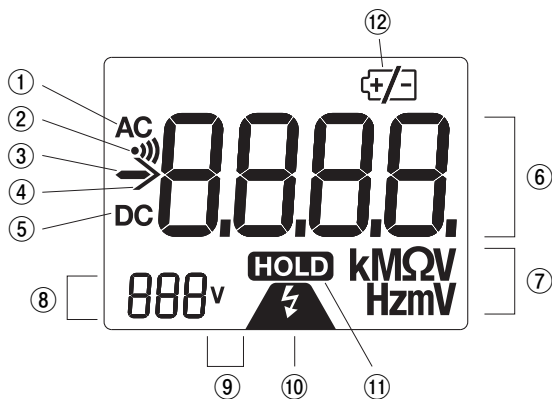


①	交流	⑦	メイン単位
②	導通チェック	⑧	サブ数値
③	極性 (マイナス)	⑨	サブ単位
④	オーバーレンジ表示	⑩	電圧警告
⑤	直流	⑪	データホールド
⑥	メイン数値	⑫	電池消耗警告

【4】機能説明 (MG601、MG601-M 共通)

4-1 テストリード固定機能

テストリード (赤) を本体側面のテストリード固定位置に差し込み、テストリードを固定できます。下図のように、固定部分を回して本体の溝の位置と合わせ (溝の角度は二種類)、テストリード (赤) の突起を溝に差し込みます。必ずテストリード (赤) が固定されるまで差し込んでください。

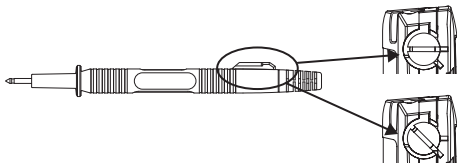

4-2 電源ボタン：⏻

本器の電源が OFF の状態でこのボタンを 2 秒以上押すと電源が ON します。表示器、緑色バックライト、各ボタン (AUTOV ボタン・ Ω ボタン・ \bullet) ボタン・Hz ボタン・DCmV ボタン・各テスト電圧選択ボタン) LED が約 1 秒間点灯します。その後、電圧測定機能に切り換わります。

電源が ON の状態でこのボタンを押すと電源が OFF します。

4-3 電圧測定機能：AUTOV ボタン

このボタンを押すと、電圧測定機能に切り換わりボタンの LED が点灯します。交流・直流を自動で判別して測定します。

4-4 抵抗測定機能： Ω ボタン

このボタンを押すと、抵抗測定機能に切り換わります。抵抗測定機能に切り換わるとボタンの LED が点灯します。

4-5 導通チェック機能： \bullet) ボタン

このボタンを押すと、導通チェック機能に切り換わります。導通チェック機能に切り換わるとボタンの LED が点灯します。

4-6 周波数測定機能：Hz ボタン

このボタンを押すと、周波数測定機能に切り換わります。周波数測定機能に切り換わるとボタンの LED が点灯します。


 
4-7 直流電圧 (DCmV) 測定 兼 速度表示機能：DCmV ボタン

このボタンを押すと、DCmV 測定機能に切り換わります。DCmV 測定機能に切り換わるとボタンの LED が点灯します。速度表示機能は、別売りの SE-9000 (生産終了品) / SE9100 と組み合わせる必要があります。


4-8 テスト電圧選択機能：15 V/500 V ボタン

いずれかのボタンを押して、絶縁抵抗測定時のテスト電圧を選択します。選択したボタンの LED が点灯し、表示器のサブ数値部にテスト電圧を表示します。


4-9 絶縁抵抗測定機能：TEST MΩ ボタン

このボタンの右側 ( 部分) を押すと、押している間だけテスト電圧が発生し、絶縁抵抗を測定します。連続測定時は、このボタンの左側 ( マーク部分) を立てて固定します。

測定を停止するにはボタンを放す、または立てた部分を戻します。その際、最後の測定値を表示器にホールドします。

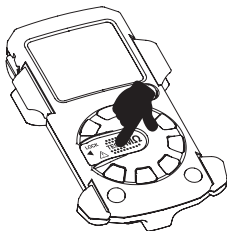

TEST MΩ ボタンを押す

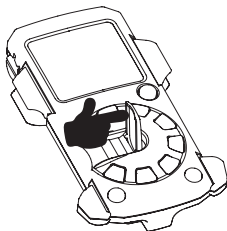

TEST MΩ ボタンを立てて固定

備考：

- ・測定終了時にホールドした測定値は、次の測定開始までホールドされます。
- ・電源を ON した時に **TEST MΩ** ボタンが押されていた（または立てられていた）場合は、表示器に [**CAto**] が表示されブザーが鳴ります。**TEST MΩ** ボタンを戻すと電圧測定機能に切り換わります。
- ・電圧測定機能・抵抗測定機能・導通チェック機能・周波数測定機能・DCmV測定機能選択時、**TEST MΩ** ボタンは使用できません。

4-10 データホールド機能：HOLD ボタン

このボタンを押すと、表示器に **HOLD** が点灯しその時点の表示値をホールド（保持）します。測定入力の変動しても表示は変化しません。再度ボタンを押すと、**HOLD** は消灯しホールド状態は解除され、測定状態に戻ります。

この機能は、電圧測定・抵抗測定・導通チェック・周波数測定・DCmV 測定でのみ有効です。

4-11 バックライト機能：☼ ボタン

☼ ボタンを押すと表示器にバックライトが点灯します。再度ボタンを押すと消灯します。電池の消耗を抑えるため使用後はバックライトを消灯してください。


備考：

- ・バックライトは自動で消灯しません。

4-12 オートパワーオフ機能

最後のボタン操作から約15分で自動的に電源がOFFされ、電池の消耗を抑えるオートパワーオフ機能つきです。電源が切れる前にブザーが10回鳴ります。

4-13 電池消耗警告表示

電池が消耗し電池電圧が約 4.3 V 以下になった時、表示器に  が点灯します。その場合は新しい電池と（4本共に）交換してください。（6-4 参照）

電池がさらに消耗し、本器が機能できない状態まで消耗すると、数値部に [**bAtt**] を表示し、電源がOFFになります。

4-14 電圧警告表示・ブザー



10 Vを超える交流または直流電圧が測定端子に印加(または出力)されている可能性がある時に  が点灯します。

データホールド (4-10 参照) によって測定値表示が固定されている場合も、本警告機能は動作します。(測定値は変化しません)

この機能は、電圧測定・絶縁抵抗測定でのみ有効です。

4-15 ディスチャージ (放電) 機能

絶縁抵抗測定時に、容量性の被測定物を測定するとテスト電圧で充電されるため、被測定物に残る高電圧を放電させて感電事故を防ぎます。

 
測定終了後テストリードを被測定物に接続したままで **TEST MΩ** ボタンを OFF すると、自動でディスチャージ (放電) が始まります。表示器に  が点灯している間は充電されている電荷が放電中であることを示します。 が消灯すると放電が完了あるいは被測定物の充電圧が 10 V 以下であることを示します。


備考：


- ・放電中は、**AUTOV** ボタン、**Ω** ボタン、**Hz** ボタン、**●)** ボタン、**DCmV** ボタン、**HOLD** ボタンは無効になります。他のファンクションに変更できず、ボタン操作無効のブザー音が鳴ります。

4-16 ブザー解除機能

ブザー音を消す機能です。

電源 OFF の状態で、 ボタンを押したまま電源ボタンを長押し (2 秒以上) して、表示器に [SELE] と表示されるまで押し続けると、
●)) ボタンの LED が点灯します。●)) ボタンを押して、LED を消灯させるとブザー音が解除されます。ブザー音を有効にするには、もう一度電源ボタンを押して LED を点灯させるか、または一度電源を OFF にし、再度電源を ON にすると自動で解除されます。

 ボタンを長押し (2 秒以上) すると、表示器に [ConF] が表示されて設定が確定し、その後電圧測定状態になります。

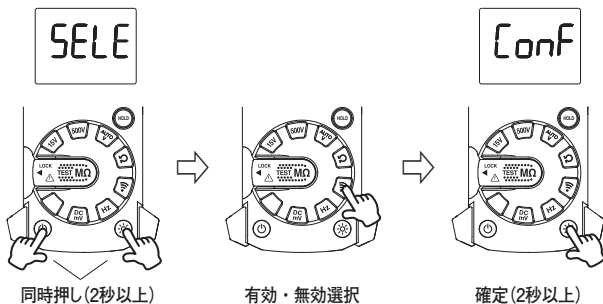

備考：

- ・ 設定を確定せずに途中で電源をOFFした場合は、変更した設定は破棄されます。
- ・ ブザー音を無効にした場合でも、導通チェック機能でのブザー音および電圧測定・絶縁抵抗測定機能での電圧警告表示時のブザー音は消えません。

 
【5】測定方法



⚠ 警告

1. 各測定機能の最大定格値を超えた入力を加えないこと。
2. 測定中は測定機能を切り換えないこと。
3. 測定中はテストリードおよびアリゲータクリップのつばより先端側を持たないこと。
4. 測定後は被測定物からテストリードを離し、電源を OFF にする。
5. 測定対象の測定カテゴリに適合したテストリードを使用すること。
測定カテゴリの違う本体やテストリードの組み合わせでは、低い測定カテゴリに制限されます。
6. 本機は精密機器のため、落下などで衝撃を与えないよう、注意して使用すること。

5-1 始業点検

測定を始める前に以下の項目を確認してください。

- ・ 外観チェック:落下などにより本体外観に異常はないですか?
- ・ アクセサリ:テストリードに断線やひび割れ等の異常はないですか?
- ・ 電池:初回使用時は電池を取り付けてください。電池消耗警告  が表示されていませんか? 表示されている場合はすべて新品電池と交換してください。表示器に何も表示が出ない場合は、電池の全消耗が考えられます。(6-4 参照)
- ・ 導通チェック機能 (●)) にてテストピンをショートさせることでテストリードの断線を確認します。
- ・ 本体または手が水などでぬれた状態ではないですか?

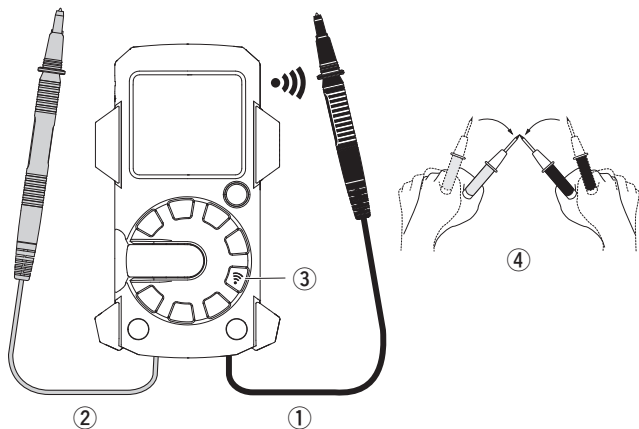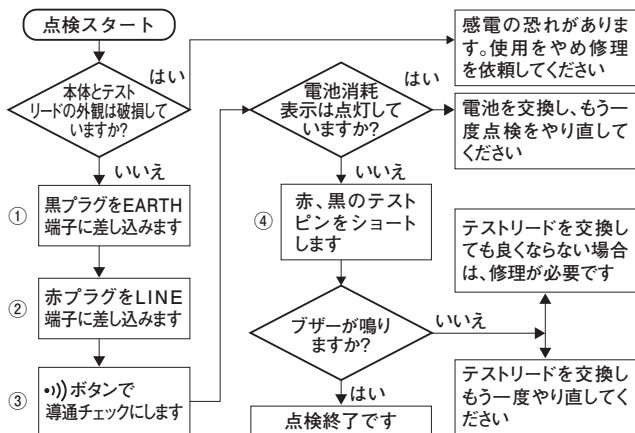


5-2 電圧測定 (AUTOV)

機能	最大定格入力値	レンジ
電圧測定	AC/DC 600.0 V	600.0 V


入力電圧が交流 (AC) か直流 (DC) かを自動で判別して測定します。

測定手順：

- ① **AUTOV** ボタンを押します。
- ② 被測定物にテストリードを接続します。
- ③ 表示器の測定値を読み取ります。

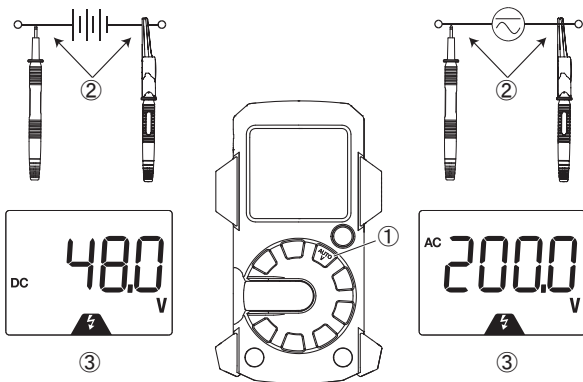

備考：


- ・ 入力が AC/DC 0.5 V 以下のときは、[Auto] 表示になります。
- ・ AC/DC 10 V 以上で表示器に  が点灯し、ブザー (ビピ) が鳴ります。
- ・ 直流と交流が重畳しているときは、ピーク値が高い方を表示します。
- ・ **TEST MΩ** ボタンは使用できません。
- ・ 測定機能使用時、テストリード巻取りリールにテストリードのケーブルが巻かれている状態でも測定可能です。

5-3 周波数測定 (Hz)

機能	最大定格入力値	レンジ
周波数測定	AC 600.0 V 1999 Hz	999.9 Hz/1999 Hz

測定手順：

- ① Hz ボタンを押します。
- ② 被測定物にテストリードを接続します。
- ③ 表示器の測定値を読み取ります。

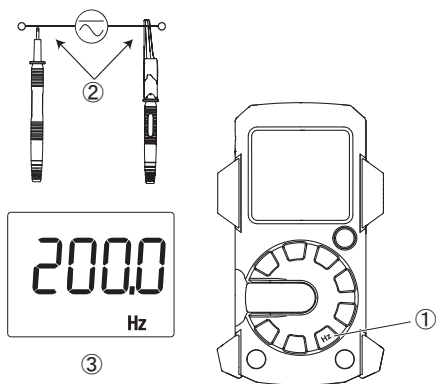

備考：

- ・ 直流と交流が重畳しているときは、ピーク値が高い方を表示します。
- ・ **TEST MΩ** ボタンは使用できません。

5-4 抵抗測定 (Ω)


⚠ 警告

測定端子には外部から電圧を絶対に加えないこと。

機能	最大定格入力値	レンジ
抵抗測定	999.9 k Ω	999.9 Ω /9.999 k Ω /99.99 k Ω /999.9 k Ω

測定手順：

- ① Ω ボタンを押します。
- ② 被測定物にテストリードを接続します。
- ③ 表示器の測定値を読み取ります。

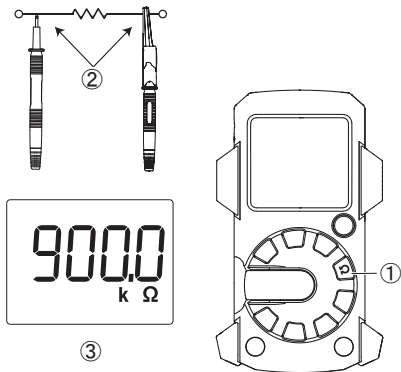

備考：

- ・測定端子間の開放電圧：約 DC 2 V 以下
- ・**TEST M Ω** ボタンは使用できません。

5-5 導通チェック (•))


⚠ 警告

測定端子には外部から電圧を絶対に加えないこと。

機能	最大定格入力値	レンジ
導通チェック	999.9 Ω	999.9 Ω

測定手順：

- ① •)) ボタンを押します。
- ② 被測定物にテストリードを接続します。
- ③ 表示器の測定値を読み取ります。

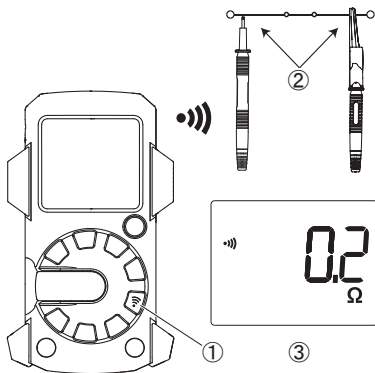

備考：

- ・ 導通ブザー発音範囲：約30 Ω 以下
- ・ 測定端子間の開放電圧：約 DC 2 V以下
- ・ **TEST M Ω** ボタンは使用できません。
- ・ 導通チェック時に **HOLD** を押すと、その後の導通状態に関わらず、表示とブザー音を保持します。


5-6 直流電圧 (DCmV) 測定 兼 速度表示機能

機能	最大定格入力値	レンジ
DCmV 測定	DC 2000 mV	DC 2000 mV

測定手順：

- ① DCmV ボタンを押します。
- ② 2000 mVまでの直流電圧測定を行う場合、「5-2 電圧測定 (AUTOV)」と同様の手順で測定します。
- ③ 速度表示をする場合、別売品のSE-9000 (生産終了品) / SE9100 速度計からのアナログ出力用コードのテストピン赤+側をALE101 (赤) を中継してLINE端子に、テストピン黒-側をALE101 (黒) を中継してEARTH端子にそれぞれ接続します。
- ④ 表示器の測定値を読み取ります。速度計のアナログ出力値の測定値 [mV] をそのまま [m/min] として読み取ります。

※読み取り例:測定値1000 [mV] の時、速度1000 [m/min] となります。

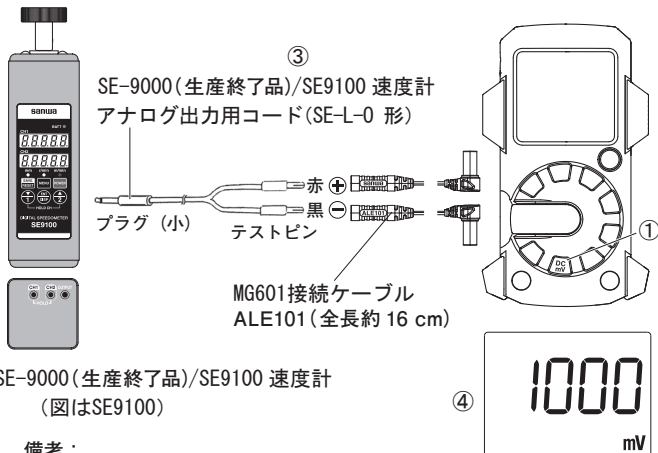

SE-9000 (生産終了品) / SE9100 速度計
(図はSE9100)

備考：

- ・ TEST MΩ ボタンは使用できません。
- ・ SE-9000 (生産終了品) / SE9100速度計接続時は必ずDCmVボタンを押しDCmV測定ファンクションで使用してください。

5-7 絶縁抵抗測定

⚠ 警 告

1. 測定端子には電圧を絶対に加えないでください。
2. 被測定物(回路)の電源を切り離し、電圧がかかっていないことを確認してから測定してください。
3. 測定中は本器から高電圧を発生するため測定中は被測定物に手を触れないでください。
4. 測定直後は、本器および被測定回路が高電圧で充電されているので感電に注意してください。
5. 感電のおそれがあるため、測定後は必ず被測定物に充電された高電圧を放電してください。(4-15 参照)

⚠ 注 意


1. 絶縁抵抗測定時、本器の測定端子には高電圧が発生しています。耐電圧が低いまたは不明の機器及び部品(半導体など)の接続されている回路(回路)では、破損防止上それらを回路より外して測定することをお勧めします。特にコンピュータ関連機器の場合、注意が必要です。
2. 測定対象の電源が入力されている状態の時は測定をしないでください。
3. 絶縁抵抗測定では、被測定回路の使用電圧になるべく近いテスト電圧で測定してください。
4. 絶縁抵抗測定時、被測定回路に、静電容量成分が含まれている場合、測定値が安定するまでに、時間が掛かることがあります。
5. 被測定物が接地(アース)されているときには、通常接地側に黒テストリード(EARTH)を、回路側へ赤テストリード(LINE)を接続します。(このように接続した方が、逆に接続した場合より一般に小さな値となる)
6. 測定誤差を防止するため、LINE 側に接続したテストリードは、被測定物や大地になるべく触れないようにして測定します。
7. 絶縁抵抗は、温度や湿度によって大きく変化します。
印加する電圧(テスト電圧)によっても変化します。
一般に温度、湿度、電圧がそれぞれ高い程、絶縁抵抗値は低くなります。
8. 測定の際、発振音が聞こえても故障ではありません。


テスト電圧	最大定格入力値	レンジ
15 V	21.0 MΩ	0.999 MΩ/9.99 MΩ/21.0 MΩ
500 V	210 MΩ	0.999 MΩ/9.99 MΩ/99.9 MΩ/210 MΩ

絶縁抵抗測定原理：

直流電圧を印加中に測定対象に流れる電流を検出し、[絶縁抵抗＝電圧／電流] で求めます。


測定手順：


- ① 測定するテスト電圧選択ボタンを押します。
- ② 黒テストリード(アリゲータクリップ)を接地側に、赤テストリードを測定対象にそれぞれ接続します。
- ③ **TEST MΩ** ボタンを押します。
- ④ 表示器の測定値を読み取ります。
- ⑤ テストリードを被測定物に接続した状態で **TEST MΩ** ボタンをOFFします。最後の測定値をホールド表示し、自動放電を開始します。被測定物の電圧が 10 V 以下になると表示器の  が消灯します。(4-15 参照)

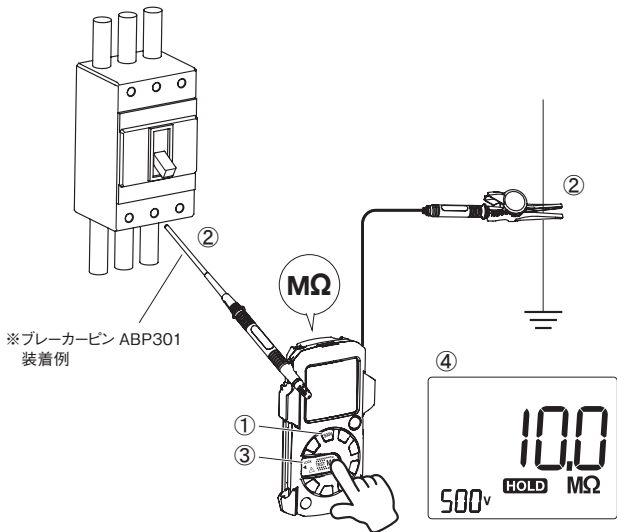

絶縁抵抗の測定例

備考：

 - ・ 被測定対象が活線状態 (≥ 10 V AC/DC) の場合、表示器に電圧値と  を表示しブザーを鳴らします。このとき、**TEST MΩ** ボタンを押しても測定電圧を発生しません。被測定対象の電源を切ってから再度測定をしてください。



- ・ 測定対象に 10 V 未満の電圧 (ゴースト電圧等) が存在する場合、絶縁抵抗測定は行えませんが表示値が不安定になる場合があります。

【6】 保守管理について

⚠ 警 告

1. この項目は安全上重要です。本説明書をよく理解して管理をおこなうこと。
2. 安全と確度維持のために1年に1回以上は校正、点検を実施すること。

6-1 保守点検

- 1) 外観：
 - ・落下などにより、外観が壊れていませんか？
- 2) テストリード：
 - ・テストリードが傷んでいたり芯線が露出したりしていませんか？

以上の項目に該当するものは、そのまま使用せず修理を依頼するか新品と交換してください。

6-2 校 正

校正、点検については三和電気計器（株）・羽村工場サービス部までお問い合わせください。（項目7-2「送り先」参照）

6-3 清掃と保管について

⚠ 注 意


1. 本体は揮発性溶剤に弱いため、シンナーやアルコールなどで拭いたりしないこと。汚れは柔らかい布に少量の水を含ませてふき取ってください。
2. 本体は熱に弱いため、高熱を発するものの近くに置かないこと。
3. 振動の多い場所や落下のおそれのある場所に保管しないこと。
4. 直射日光下や高温、低温、多湿、結露のある場所での保管は避けること。
5. 長期間使用しない場合は電池を必ず抜いておくこと。

6-4 電池交換

⚠ 警告

1. 感電のおそれがあるため、測定端子に入力が加わった状態、または測定状態で電池ふたをはずさないこと。
2. 電源がOFFしていることを確認してから電池交換作業をおこなうこと。

- ① 電池ふたの固定ねじ (1本) をプラスねじ回しでゆるめます (ねじは電池ふたから外れません)。
- ② 電池ふたが浮き上がったらはずします。
- ③ 電池ホルダ内の電池を極性に注意して4本共に新品と交換します。
- ④ 電池ふたの固定ねじを元どおりに締めます。

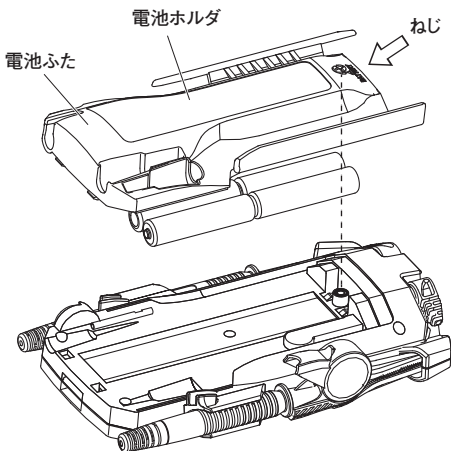

【7】アフターサービスについて

7-1 保証期間について

本製品の保証期間は、お買い上げの日より3年間です。

ただし、日本国内で購入し日本国内でご使用いただく場合に限り
ます。また、製品本体の確度は1年保証、製品付属の電池、テスト
リード等は保証対象外とさせていただきます。

7-2 修理について

- 1) 修理依頼の前にもう一度次の項目をご確認ください。
 - ・電池の容量はありますか？ 電池装着の極性は正しいでしょうか？
 - ・テストリードは断線していませんか？
- 2) 保証期間中の修理
保証書の記載内容によって修理させていただきます。
- 3) 保証期間経過後の修理
 - ・修理によって本来の機能が保持できる場合、ご要望により有料で修理させていただきます。
 - ・修理費用や輸送費用が製品価格より高くなる場合もありますので、事前にお問い合わせください。
 - ・本品の補修用性能部品の最低保有期間は、製造打切り後6年間です。この保有期間を修理可能期間とさせていただきます。ただし、購入部品の入手が製造会社の製造中止等により不可能になった場合は、保有期間が短くなる場合もあります。
- 4) 修理品の送り先
 - ・製品（本体およびテストリード等の付属品を含む）の安全輸送のため、製品の5倍以上の容積の箱に入れ、十分なクッションを詰めてお送りください。
 - ・箱の表面には「修理品在中」と明記してください。
 - ・輸送にかかる往復の送料は、お客様のご負担とさせていただきます。

[送り先] 三和電気計器株式会社・羽村工場サービス部
〒205-8604 東京都羽村市神明台4-7-15
TEL (042) 554-0113 / FAX (042) 555-3255

7-3 お問い合わせ

三和電気計器株式会社

本社 : TEL (03) 3253-4871 / FAX (03) 3251-7022

大阪営業所 : TEL (06) 6631-7361 / FAX (06) 6644-3249

製品について : ☎ 0120-51-3930

お問い合わせ 受付時間9:30~12:00 13:00~17:00

(土日祝日および弊社休日を除く)

ホームページ : <https://www.sanwa-meter.co.jp>

[8] 仕様 (MG601、MG601-M 共通)

8-1 一般仕様

動作方式	Δ-Σ方式
交流検波方式	真の実効値方式
表示	メイン数値 9999カウント(電圧、抵抗、導通チェック) 210カウント(MΩ) 1999カウント(周波数)
サンプルレート	約 2 回/秒 (DCV)
オーバー表示	メイン数値部 "9999 (または各MΩ測定電圧レンジの最大値(点滅))" かつ ">" 点滅
レンジ切り換え	オートレンジのみ
極性切り換え	自動切換え(−のみ表示)
電池消耗表示	約 4.3 V以下で表示器に☒マークが点灯
使用環境条件	高度2000 m以下、屋内使用、環境汚染度Ⅱ
使用温湿度範囲	0 ~40 °C、90 %RH 以下(結露のないこと)
確度保証温湿度範囲	23±5 °C、80 %RH以下(結露のないこと)
保存温湿度範囲	-10 ~60 °C、90 %RH以下 結露のないこと(電池を除く)
電源	単4形アルカリ乾電池 (LR03) 1.5 V×4本
オートパワーオフ	最終操作から約15分後に電源OFF 約10 μA
測定可能回数	約 400 回(500 V以下 定格測定電圧×0.001 MΩ測定) 5秒ON 25秒OFF
寸法・質量	H 147 × W 68 × D 30 mm・約298 g (突起部含まず・電池含む)
製造年	本体裏面シリアル番号の先頭2桁で西暦20**年を示す。

IP等級	IP30 (測定プローブ装着状態)
安全規格	IEC61010-1 CAT.IV300 V CAT.III600 V、IEC61010-031、IEC61010-2-033、IEC61010-2-034、IEC61557-1,2
EMC	IEC61326
付属品	取扱説明書、テストリード(ATL102)、アリゲータクリップ(AAL301)、プレーカーピン(ABP301)、単4形アルカリ乾電池(LR03)×4 接続ケーブル(ALE101)*、携帯ケース(C-DG3a)*、ハンガーマグネット(HM-1)* ※MG601-Mのみ付属

8-2 別売品

ハンガーマグネット：HM-1、携帯ケース：C-DG3a、単3用電池ホルダ：BH1、接続ケーブル：ALE101、クリップアダプタ：AAL302 (※安全規格外)

8-3 測定範囲および精度

精度保証温湿度範囲：23±5℃、80%RH以下 結露のないこと
外部磁界：なし 電池電圧：電池有効範囲内
rdg: reading (読み取り値) dgt: digits (最下位桁)

AUTOV 直流・交流電圧

レンジ	精度	入力抵抗	備考
600.0 V	±(1.2%rdg + 5dgt)	約10 MΩ	・測定範囲 DC：0.5 V以上または -0.5 V以下 AC：0.5 V以上 (ACの場合) ・精度保証周波数範囲：45~400 Hz (正弦波)

DCmV 直流電圧 (速度)

レンジ	精度	入力抵抗	備考
2000 mV	±(0.5% + 11dgt)	約10 MΩ	・速度計SE-9000(生産終了品)/SE9100連携のアナログ入力用

Hz 周波数

レンジ	精度	備考
1999 Hz	±(0.5%rdg + 5dgt)	・感度：約 0.5 Vrms 以上 ・精度保証範囲：45 Hz 以上 ・測定範囲：1 Hz~1999 Hz

Ω 抵抗

レンジ	確 度	備 考
999.9 Ω	±(1.5 %rdg + 7dgt)	開放電圧 約DC 2.0 V以下
9.999 kΩ		
99.99 kΩ		
999.9 kΩ		

㉿) 導通チェック

レンジ	確 度	備 考
999.9 Ω	±(1.5 %rdg + 7dgt)	開放電圧 約 DC 2.0 V以下 ブザー発音範囲: 約 30 Ω以下

絶縁抵抗

テスト電圧	レンジ	第一有効測定範囲 確度: ±(4.0 %rdg)	第二有効測定範囲 確度: ±(8.0 %rdg)	その他測定範囲 確度: ±(2.0 %rdg +6dgt)	備考
15 V	0.999 MΩ 9.99 MΩ 21.0 MΩ	0.200~ 11.0 MΩ	11.1~ 21.0 MΩ	0.000~ 0.199 MΩ	21.0 MΩ 以上でオーバー表示※
500 V	0.999 MΩ 9.99 MΩ 99.9 MΩ 210 MΩ	0.200~ 110 MΩ	111~ 210 MΩ	0.000~ 0.199 MΩ	210 MΩ 以上でオーバー表示※

※各テスト電圧のオーバー表示

15 V: > 21.0 MΩ (点滅)

500 V: > 210 MΩ (点滅)

- ・定格電流: 1 mA (1 mA ~ 1.2 mA)
- ・開放回路電圧の許容範囲: 定格測定電圧の 1 ~ 1.25 倍
- ・定格測定電圧を維持できる下限抵抗値: 定格測定電圧 × 0.001 MΩ
(例) 500 V のとき 0.5 MΩ

テスト電圧 (= 定格測定電圧) とは出力電圧の定格電圧値であり、出力電圧は測定中の負荷 (上記の下限抵抗値より小さい場合) により低くなる場合があります。

(例) テスト電圧 500 V で 0.1 M Ω 測定時、実際に出力されている電圧は、
 $1 \text{ mA} \times 0.1 \text{ M}\Omega = 100 \text{ V}$ となります。

IEC61557 に準じた仕様

測定	固有不確かさ	動作不確かさ
電圧	$\pm(1.6 \% \text{rdg} + 7 \text{dgt})$	$\pm 30 \%$
絶縁抵抗	$\pm(2 \% \text{rdg})$	$\pm 30 \%$

この仕様は規格によるもので、規格で許容されている最大値を示しています。

※変動の影響要素「E1:姿勢、E2:供給電圧、E3:温度」

確度計算方式

例) 電圧測定

表示値: 200.0 V

レンジ確度: 999.9 Vレンジ… $\pm(1.2 \% \text{rdg} + 5 \text{dgt})$

誤差: $\pm(200.0 \text{ V} \times 1.2 \% + 5 \text{dgt}) = \pm 2.9 \text{ V}$





真値: 200.0 V $\pm 2.9 \text{ V}$ (197.1 ~ 202.9 V の範囲内)

※999.9 Vレンジにおける5dgtとは0.5 Vに相当します。

ここに掲載した製品の仕様や外観は改良等の理由により、予告なしに変更することがありますのでご了承ください。



MEMO

CONTENTS

[1] SAFETY PRECAUTIONS: Before use, read the following safety precautions	
1-1 Explanation of Warning Symbols	30
1-2 Warning Messages for Safe Use	30
1-3 Overload Protection Input Value	31
[2] APPLICATIONS AND FEATURES	
2-1 Applications	32
2-2 Features	32
[3] NAMES OF COMPONENT UNITS	
3-1 Main Unit & Test Leads	33
3-2 Display	34
[4] DESCRIPTION OF FUNCTIONS (MG601/MG601-M)	
4-1 Fixing the Test Lead	35
4-2 Power Button: 	35
4-3 Voltage Measurement Function: AUTOV Button	35
4-4 Resistance Measurement Function: Ω Button	35
4-5 Continuity Check:  Button	35
4-6 Frequency Measurement: Hz Button	36
4-7 DC Voltage (DCmV) Measurement / Speed Display Function: DCmV Button ..	36
4-8 Test Voltage Selection Function: 15 V/500 V Buttons	36
4-9 Insulation Resistance Measurement Function: TEST MΩ Button ..	36
4-10 Data Hold Function: HOLD Button	37
4-11 Backlight:  Button	37
4-12 Auto Power-Off	37
4-13 Low Battery Warning	37
4-14 Voltage Warning/Buzzer	37
4-15 Discharge Function	38
4-16 Buzzer Cancellation Function	39
[5] MEASUREMENT PROCEDURE	
5-1 Start-up Inspection	40
5-2 Voltage Measurement (AUTOV)	42
5-3 Frequency Measurement (Hz)	43
5-4 Resistance Measurement (Ω)	44
5-5 Continuity Check ()	45
5-6 DC Voltage (DCmV) Measurement / Speed Display Function	46
5-7 Insulation Resistance Measurement	47
[6] MAINTENANCE	
6-1 Maintenance and Inspection	50
6-2 Calibration	50
6-3 Cleaning and Storage	50
6-4 Battery Replacement	51
[7] AFTER-SALE SERVICE	
7-1 Warranty and Provision	52
7-2 Repair	52
7-3 SANWA Website	53
[8] SPECIFICATIONS (MG601/MG601-M)	
8-1 General Specifications	54
8-2 Optional Accessories	55
8-3 Measuring Range and Accuracy	55


[1] SAFETY PRECAUTIONS: Before use, read the following safety precautions

This instruction manual explains how to use your MG601/MG601-M digital insulation resistance tester safely. Before use, please read this manual thoroughly to ensure correct and safe use. After reading it, keep it together with the product for reference to it when necessary. Using this product in ways not specified in this manual may damage its protection function.










The instructions given under the headings of “ WARNING” and “ CAUTION” must be followed to prevent accidental burn and electrical shock.

1-1 Explanation of Warning Symbols

The meanings of the symbols used in this manual and attached to the product are as follows.

-  : Extremely important instructions for safe use
- WARNING identifies conditions and actions that could result in accidental burn and electric shock.
 - CAUTION identifies conditions and actions that could cause damage to the instrument.

Symbols attached to this instrument

-  : Refer to the instruction manual before use.
-  : Do not touch this part because a dangerous high voltage is applied.
-  : Double or reinforced insulation  : Ground
-  Ω : Resistance  : Continuity  : Backlight
-  : Power button  : TEST M Ω button locked position

1-2 Warning Messages for Safe Use

WARNING

To prevent injuries such as burns or electric shocks, ensure strict compliance with the following instructions when using this instrument:

1. This instrument is designed for low-voltage insulation resistance testing. Do not use it on electrical circuits exceeding 600 V.
2. Do not input signals exceeding the maximum rated input value (see 1-3).
3. Do not use the instrument to measure lines connected to equipment (e.g., motors) that may generate induced or surge voltages, as these may exceed the maximum allowable input.

4. Do not use the instrument if the main unit or test leads are damaged or broken.
5. Do not use the instrument with the case or battery cover removed.
6. When measuring, do not hold a test pin side of the flange of the measurement probe or an alligator clip side of the barrier of the alligator clip.
7. Do not switch functions during measurement.
8. Always confirm the correct function before starting a measurement.
9. Do not use the instrument when it is wet or with wet hands.
10. Do not perform repairs or modifications, except for replacing the batteries or fuse.
11. Be sure to perform pre-operational checks and at least one annual inspection.
12. Use the instrument indoors only.
13. Use insulated protective gear to prevent accidents in facilities with dangerous live electrical parts. Ensure compliance with local and national safety standards.
14. Do not use the instrument in any manner not specified in this manual, as it may compromise its protective functions.

 **CAUTION**

1. Correct measurements may not be possible near devices that generate strong magnetic fields, such as transformers or high-current lines, emit electromagnetic waves, such as radios, or are electrically charged.
2. This instrument may malfunction or fail to measure correctly with special waveforms, such as those from inverter circuits.

1-3 Overload Protection Input Value

Function	Measurement terminal	Max. rated input value	Max. overload protection input value
Insulation resistance	LINE, EARTH	—	660 V DC/AC
AUTOV		600 V DC/AC	
Ω		Voltage input prohibited	
Hz		1999 Hz	
DCmV		2000 mV DC	

[2] APPLICATIONS AND FEATURES

2-1 Applications

This instrument is a DC insulation resistance tester designed to measure insulation resistance of electric lines and electric equipment in the range of the CAT. IV 300 V and CAT. III 600 V. When connected to the optional SE9100 digital speedometer, it also enables direct reading of the output voltage corresponding to speed.

2-2 Features

- Safety design compliant with IEC61010/IEC61557 standards.
- Pocket-sized, with a rated current of 1 mA or more for insulation resistance measurements.
- Automatically holds readings after insulation resistance measurement.
- Large, easy-to-read LCD with backlight.
- Includes a breaker pin for measuring through a hole in a circuit breaker cover.
- Comes with a pin cap holder.
- LED-illuminated buttons for clear indication of test voltage.
- Auto power-off function (approximately 15 minutes), with the option to disable.
- Auto discharge function.
- Connecting the optional SE9100 digital speedometer enables remote speed measurement of equipment such as elevators and belt conveyors.
- If the measurement target is live (10 V or more) when the test leads are applied and before the TEST MΩ button is pressed, the device automatically detects the voltage, displays it, and does not generate test voltage.

Measurement Category (Overvoltage Category)

Overvoltage measurement classification (CAT. II):

Line on the primary side of equipment with the power cord to be connected to the receptacle.

Overvoltage measurement classification (CAT. III):



Line from the primary side or branch of equipment which directly takes in electricity from a distribution board to the receptacle.

Overvoltage measurement classification (CAT. IV):

Line from the service conductor to the distribution board.


[3] NAMES OF COMPONENT UNITS

3-1 Main Unit & Test Leads

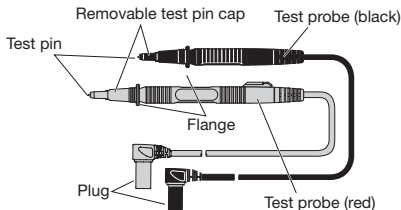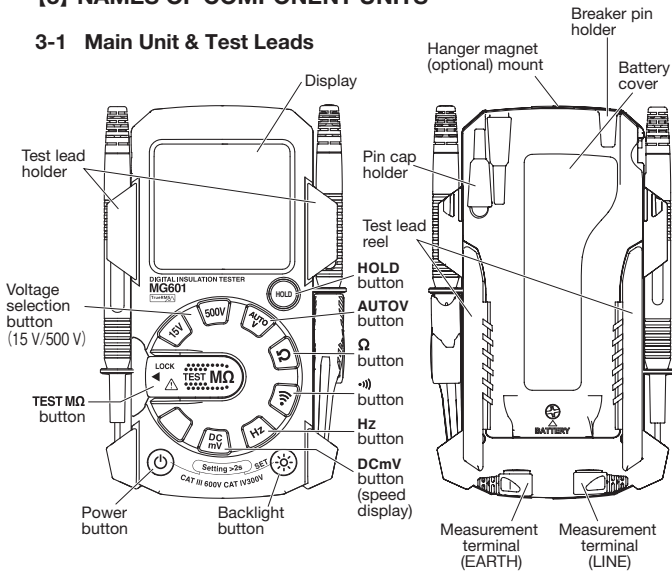

Test leads* (red/black) ATL102

 Removable test pin covers
 When covered: CAT. IV 300 V
 CAT. III 600 V
 When not covered: CAT II 1000 V



Alligator clip (black) AAL301




Breaker pin (red) ABP301

Note:

The optional AAL302 black clip adapter, designed for the M53 digital insulation resistance tester, can also be used (not certified to safety standards).

* The test leads can be used while kept wound on the reel. Adjust them to a suitable length for use.

3-2 Display

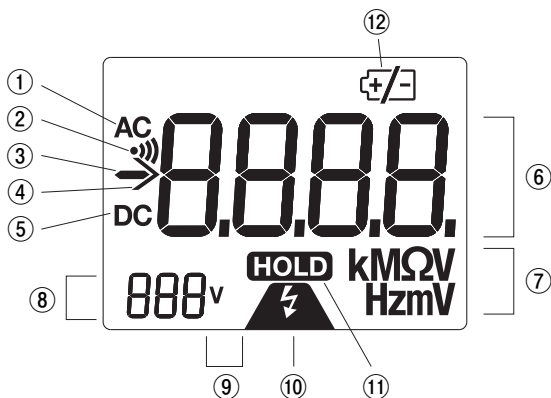


①	AC	⑦	Primary unit
②	Continuity check	⑧	Secondary value
③	Polarity (negative)	⑨	Secondary unit
④	Over-range	⑩	Voltage warning
⑤	DC	⑪	Data hold
⑥	Primary value	⑫	Low battery warning

[4] DESCRIPTION OF FUNCTIONS (MG601 / MG601-M)

4-1 Fixing the Test Lead

The test lead (red) can be secured to the side of the main unit. To do so, align the protrusion on the test lead (red) with the groove on the main unit, as shown in the figure below (the groove has two selectable angles). Insert the protrusion fully into the groove until the test lead (red) is securely fixed.

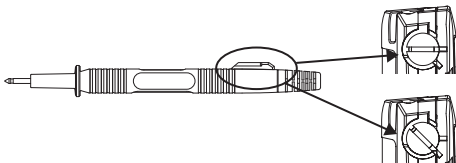

4-2 Power Button : ⏻

When the instrument is off, press and hold this button for at least 2 seconds to turn on the power. The display, green backlight, and LEDs of all buttons (**AUTOV** button, **Ω** button, **••**) button, **Hz** button, and **DCmV** button) will illuminate for approximately 1 second. The instrument will then switch to the voltage measurement function. To turn off the instrument, press this button while the power is on.

4-3 Voltage Measurement Function: **AUTOV** Button

Press this button to switch to the voltage measurement function; the LED in this button will illuminate. This function automatically detects whether the current is AC or DC and measures it accordingly.

4-4 Resistance Measurement Function : **Ω** Button

Press this button to switch to the resistance measurement function. When the resistance measurement function is active, the LED in this button will illuminate.

4-5 Continuity Check Function: **••**) Button

Press this button to switch to the continuity check function. When the continuity check function is active, the LED in this button will illuminate.

4-6 Frequency Measurement Function: Hz Button

Press this button to switch to the frequency measurement function. When the frequency measurement function is active, the LED in this button will illuminate.


4-7 DC Voltage (DCmV) Measurement / Speed Display Function: DCmV Button

Press this button to switch to the **DCmV** measurement function. When the **DCmV** measurement function is active, the LED in this button will illuminate. To use the speed display function, the optional SE-9000(discontinued)/SE9100 is required.

4-8 Test Voltage Selection Function: 15 V/500 V Buttons

Press any of these buttons to select the test voltage for insulation resistance measurement. The LED in the selected button will illuminate, and the selected test voltage will appear in the secondary value section of the display.


4-9 Insulation Resistance Measurement Function: TEST MΩ Button

Press the right side of this button ( section) to generate the test voltage and measure insulation resistance while the button is pressed. For continuous measurement, lift the left side of this button (marked with ◀) into the upright position.

To stop measurement, release the button or return the lifted side to its original position. At this time, the last measured value will remain displayed.



Press **TEST MΩ** button.

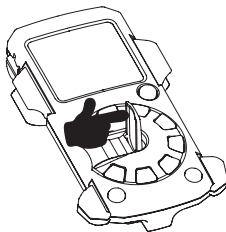

Lift **TEST MΩ** button.

Note:


- The measured value held at the end of the measurement will remain held until the start of the next measurement.
- If the **TEST MΩ** button is pressed (or lifted) when the power is turned on, [CAto] will appear on the display, and the buzzer will sound. Release the **TEST MΩ** button to switch to the voltage measurement function.
- The **TEST MΩ** button is disabled when the voltage measurement, insulation resistance measurement, continuity check, frequency measurement, or **DCmV** measurement function is selected.

4-10 Data Hold Function: HOLD Button

Press this button to activate the data hold function; **HOLD** will appear on the display. The displayed value at that moment will be held, and it will remain unchanged even if the measurement input fluctuates. Press the button again to turn off **HOLD**, disengage the data hold function, and return to measurement mode.

This function is available only for the voltage measurement, resistance measurement, continuity check, frequency measurement, and **DCmV** measurement functions.

4-11 Backlight:  Button

Press the  button to turn on the display backlight. Press the button again to turn it off. To conserve battery life, turn off the backlight after use.


Note:

- The backlight does not turn off automatically.

4-12 Auto Power-Off


After approximately 15 minutes of inactivity since the last button operation, the power automatically turns off to conserve battery life. The buzzer will sound 10 times before the power is turned off.

4-13 Low Battery Warning

When the batteries are running low and the battery voltage drops below approximately 4.3 V, the display will show . In this case, replace all four batteries with new ones (see 6-4).

If the batteries are further depleted to the point where the instrument can no longer operate, the numerical section of the display will show [bAtt], and the power will be turned off.



4-14 Voltage Warning / Buzzer

If there is a possibility that an AC or DC voltage exceeding 10 V is being applied (or output) to the measurement terminal,  will light up on the display. This warning function also operates when the measurement value is fixed using the data hold function (see 4-10), though the displayed value will not change.

This function is available only during voltage measurement and insulation resistance measurement.

4-15 Discharge Function

If you measure a capacitive object during insulation resistance measurement, it may become charged at the selected test voltage. This function prevents electric shock accidents by discharging any high voltage remaining in the object.

After completing the measurement, if you set the **TEST MΩ** button to the off position while keeping the test leads connected to the object, the discharge process will start automatically. When  appears on the display, it indicates that the remaining charge in the object is being discharged. Once  disappears, it indicates that the discharge is complete or that the remaining voltage on the object has dropped below 10 V.

Note:


- During the discharge process, the **AUTOV**, **Ω**, **Hz**, **·))**, **DCmV**, and **HOLD** buttons are disabled. Switching to other functions is disabled, and the buzzer sounds when a button is pressed.

4-16 Buzzer Cancellation Function

This function allows the buzzer sound to be turned off.

To enter this mode, ensure the power is off, then press and hold the ☼ button while pressing and holding the power button. Keep both buttons pressed until [SELE] appears on the display. The LED of the ☼ button will light up. Press the ☼ button to turn off its LED, which will cancel the buzzer sound. To reactivate the buzzer, either press the ☼ button again to turn the LED back on, or switch the power off and then on again.

To confirm the settings, press and hold the ☼ button for 2 seconds or longer. [ConF] will appear on the display, and the voltage measurement mode will then be engaged.

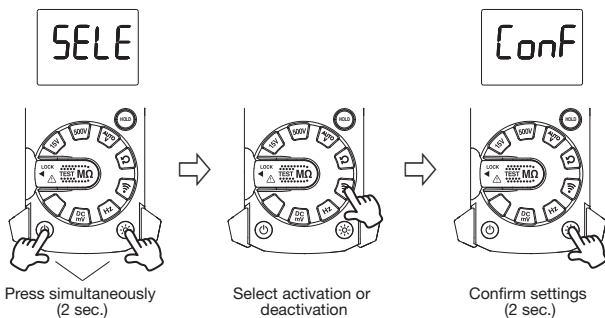

Note:

- If the power is turned off before confirming the settings, any changes will be discarded.
- Even if the buzzer is disabled, it will still sound during continuity checks and when a voltage warning is indicated in voltage measurement and insulation resistance measurement.


 
[5] MEASUREMENT PROCEDURE




WARNING

1. Do not apply inputs exceeding the maximum rated value for each measurement function.
2. Do not switch the measurement function during measurement.
3. Avoid holding the tip beyond the flanges of the test leads or the barrier of the alligator clip during measurement.
4. After completing the measurement, remove the test leads from the measurement object and turn off the power.
5. Use test leads that conform to the measurement category of the object being measured. If test leads with a different measurement category are used with the main unit, the measurement will be restricted to the lower category.
6. Since this instrument is precision equipment, handle it with care to avoid subjecting it to impacts such as dropping.

5-1 Start-up Inspection

Before starting the measurement, check the following items:

- External appearance: Are there any abnormalities in the external appearance of the main unit, such as damage caused by dropping?
- Accessories: Are there any abnormalities in the test leads, such as wire breaks or cracks?
- Batteries: For first-time use, ensure the batteries are installed. Does the low battery warning symbol () appear on the display? If so, replace all the batteries with new ones. If nothing appears on the display, the batteries may be completely drained (see 6-4).
- Continuity check: Use the continuity check function () to short-circuit the test pins and confirm there are no wire breaks in the test leads.
- Moisture: Ensure that neither the main unit nor your hands are wet.

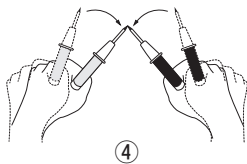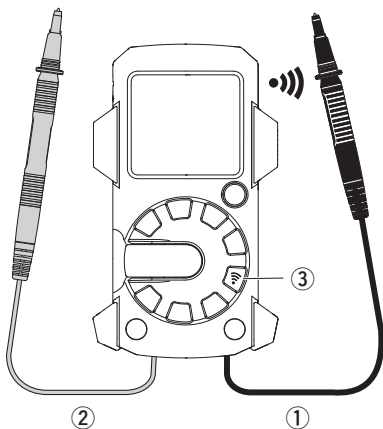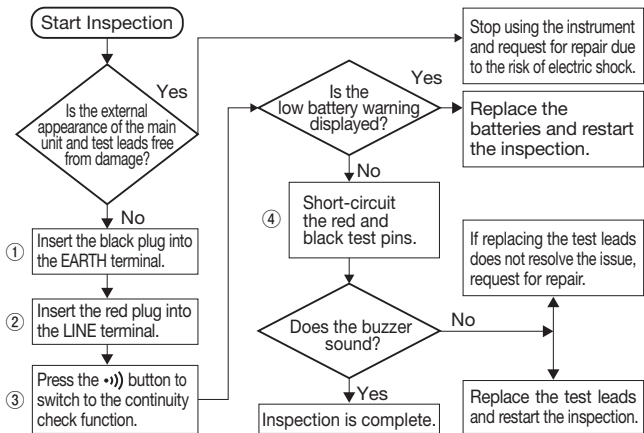


5-2 Voltage Measurement (AUTOV)

Function	Max. rated input value	Range
Voltage measurement	600.0 V AC/DC	600.0 V


This function automatically determines whether the input voltage is alternating current (AC) or direct current (DC).

How to measure:

- ① Press the **AUTOV** button.
- ② Place the test leads on the measurement object.
- ③ Read the measurement value on the display.

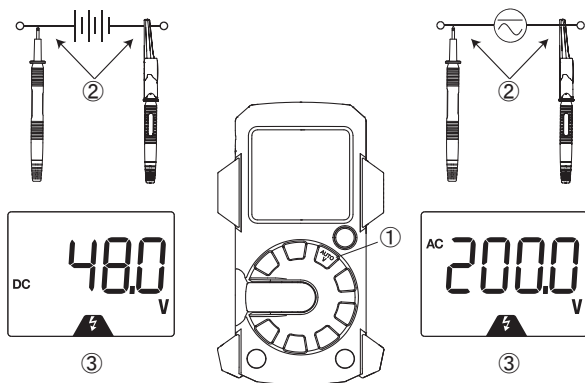

Note:


- If the input voltage is 0.5 V AC/DC or less, the display will show **[Auto]**.
- If the input voltage is 10 V AC/DC or more, the display will show  and the buzzer will emit two short beeps.
- When AC and DC are superimposed, the display will show the one with the higher peak value.
- The **TEST MΩ** button cannot be used.
- When using the measurement function, the test leads can be used even while wound on the reel.

5-3 Frequency Measurement (Hz)

Function	Max. rated input value	Range
Frequency measurement	600.0 V AC, 1999 Hz	999.9 Hz/1999 Hz

How to measure:

- ① Press the **Hz** button.
- ② Place the test leads on the measurement object.
- ③ Read the measurement value on the display.

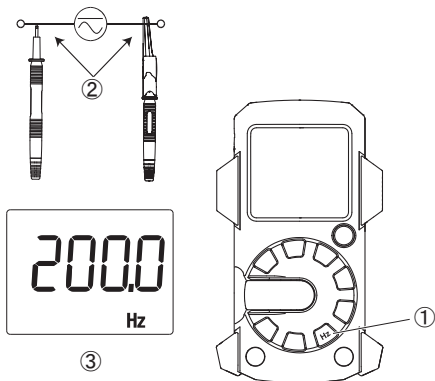

Note:

- When AC and DC are superimposed, the display will show the one with the higher peak value.
- The **TEST MΩ** button cannot be used.

5-4 Resistance Measurement (Ω)


⚠ WARNING

Never apply voltage to the measurement terminals from an external source.

Function	Max. rated input value	Range
Resistance measurement	999.9 k Ω	999.9 Ω /9.999 k Ω / 99.99 k Ω /999.9 k Ω

How to measure:

- ① Press the Ω button.
- ② Place the test leads on the measurement object.
- ③ Read the measurement value on the display.

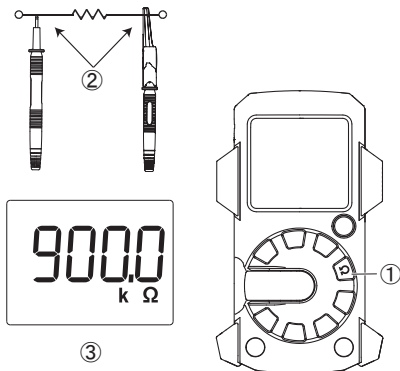

Note:

- Open-circuit voltage between measurement terminals: Approximately 2 V DC or less.
- The **TEST M Ω** button cannot be used.

5-5 Continuity Check (••))


⚠ WARNING

Never apply voltage to the measurement terminals from an external source.

Function	Max. rated input value	Range
Continuity check	999.9 Ω	999.9 Ω

How to measure:

- ① Press the ••)) button.
- ② Place the test leads on the measurement object.
- ③ Read the measurement value on the display.

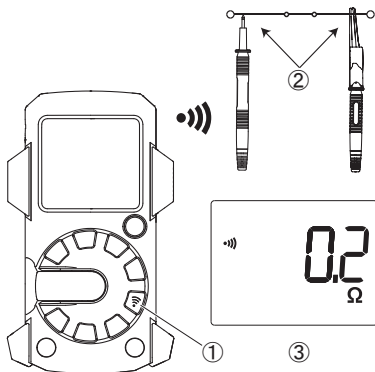

Note:

- Continuity buzzer activation range: Approximately 30 Ω or less.
- Open-circuit voltage between measurement terminals: Approximately 2 V DC or less.
- The **TEST M Ω** button cannot be used.
- When the **HOLD** button is pressed during a continuity check, the display and buzzer sound will remain unchanged, regardless of subsequent continuity conditions.


5-6 DC Voltage (DCmV) Measurement / Speed Display Function

Function	Max. rated input value	Range
DCmV measurement	2000 mV DC	2000 mV DC

How to measure:

- ① Press the **DCmV** button.
- ② To measure DC voltage up to 2000 mV, follow the same procedure as described in "5-2 Voltage Measurement (AUTO)".
- ③ To display the speed, connect the red (+) test pin of the analog output cord from the optional SE-9000(discontinued)/SE9100 speedometer to the LINE terminal via the ALE101 (red), and the black (-) test pin to the EARTH terminal via the ALE101 (black).
- ④ Read the measurement value on the display. The analog output value from the speedometer is displayed in millivolts [mV], but it should be interpreted directly as a speed value in [m/min].

Example: A measured value of 1000 [mV] corresponds to a speed of 1000 [m/min].

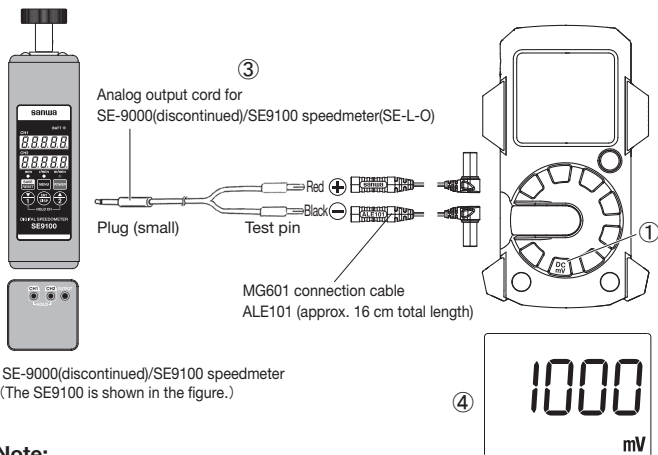

SE-9000(discontinued)/SE9100 speedometer
(The SE9100 is shown in the figure.)

Note:

- The **TEST MΩ** button cannot be used.
- When the SE-9000(discontinued)/SE9100 speedometer is connected, be sure to press the **DCmV** button and use the DCmV measurement function.

5-7 Insulation Resistance Measurement



WARNING

1. Never apply voltage to the measurement terminals.
2. Disconnect the power supply from the measurement object (circuit) and ensure that no voltage remains before performing the measurement.
3. Do not touch the measurement object while measuring, as the instrument generates high voltage during the measurement.
4. Be cautious of electric shock immediately after measurement, as both the instrument and the circuit being tested may still be charged with high voltage.
5. After measurement, always discharge any residual high voltage from the measurement object to prevent the risk of electric shock (see 4-15).



CAUTION

1. During insulation resistance measurement, high voltage is generated on the measurement terminals of this instrument. To prevent damage, it is recommended to disconnect any equipment or components (such as semiconductors) with low or unknown withstanding voltage from the circuit being tested. Special care should be taken with computer-related equipment.
2. Do not perform measurements while the power supply to the measurement object is active.
3. Perform the measurement using a test voltage as close as possible to the operating voltage of the circuit being tested.
4. If the circuit being tested contains capacitance components, the measurement may take longer to stabilize.
5. When the measurement object is grounded, connect the black test lead (EARTH) to the grounded side and the red test lead (LINE) to the circuit side. (This connection typically results in a lower value compared to the opposite connection.)
6. To prevent measurement errors, ensure that the test lead connected to the LINE side does not touch the measurement object or the ground.
7. Insulation resistance is significantly affected by temperature and humidity, and it also varies depending on the applied voltage (test voltage). Generally, the higher the temperature, humidity, or voltage, the lower the insulation resistance value becomes.
8. The presence of oscillation noise during measurement does not indicate a malfunction.


Test voltage	Max. rated input value	Range
15 V	21.0 MΩ	0.999 MΩ/9.99 MΩ/21.0 MΩ
500 V	210 MΩ	0.999 MΩ/9.99 MΩ/99.9 MΩ/ 210 MΩ

Principle of insulation resistance measurement:


The electric current flowing through the measurement target during the application of DC voltage is detected, and the insulation resistance is calculated using the formula: Insulation resistance = Voltage / Current.


How to measure:

- ① Press the test voltage selection button based on the measurement target.
- ② Connect the black test lead (alligator clip) to the grounded side and the red test lead to the measurement target.
- ③ Press the **TEST MΩ** button.
- ④ Read the measurement value on the display.
- ⑤ With the test leads still connected to the measurement target, release the **TEST MΩ** button again to turn it off. The last measured value will be held, and automatic discharge will begin. When the voltage of the measurement target falls below 10 V, ⚡ on the display will disappear (see 4-15)

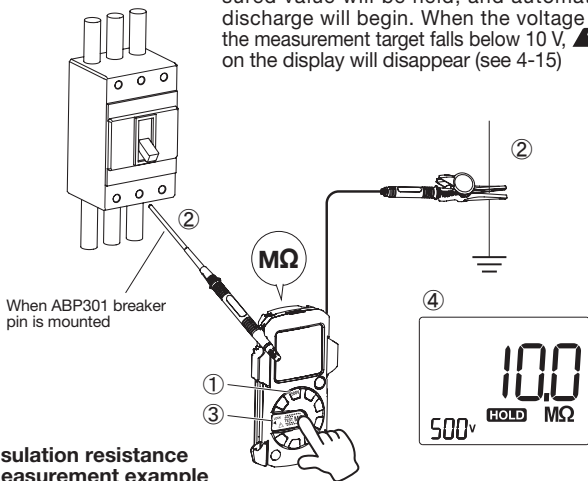

Note:

 - When the measurement target is live (≥ 10 V AC/DC), the display shows the voltage value and , and the buzzer will sound. In this state, pressing the **TEST MΩ** button will not generate measurement voltage. Turn off the power to the measurement target and retry the measurement.



- If a voltage below 10 V (e.g., ghost voltage) exists in the measurement target, insulation resistance measurement can still be performed, but the displayed value may be unstable.

[6] MAINTENANCE

WARNING

1. The following instructions are very important for safety. Read this manual thoroughly to ensure correct maintenance.
2. Calibrate and inspect the instrument at least once a year to ensure safety and maintain its accuracy.

6-1 Maintenance and Inspection

1) Appearance:

- Is the instrument not damaged due to falling or other cause?

2) Test leads:

- Are the test leads damaged or are the core wires exposed?
If any of the above problems exists, stop using the instrument and request for repair.

6-2 Calibration

For more information, please contact Sanwa's authorized agent, distributors, or service provider, listed on our website (see 7-3).

6-3 Cleaning and Storage

CAUTION


1. The body is sensitive to volatile solvents. Avoid wiping it with thinner, alcohol, or similar substances. To clean the body, use a soft cloth slightly dampened with water.
2. The body is sensitive to heat. Do not place it near heat sources or devices that generate high temperatures.
3. Avoid storing the instrument in locations subject to vibration or where there is a risk of it falling.
4. Do not store the instrument in environments exposed to direct sunlight, extreme heat or cold, high humidity, or conditions where condensation may occur.
5. If the instrument will not be used for an extended period, always remove the batteries beforehand.

6-4 Battery Replacement

⚠ WARNING

1. To prevent the risk of electric shock, do not remove the battery cover while input is applied to the measurement terminals or during measurement.
2. Ensure the power is turned off before proceeding with battery replacement.

- ① Use a Phillips screwdriver to loosen the fixing screw (x1) on the battery cover (the screw will remain attached to the cover).
- ② Once the battery cover has lifted, remove it.
- ③ Carefully observe the polarities of the batteries in the battery holder and replace all four batteries with new ones.
- ④ Secure the fixing screw on the battery cover back to its original position.

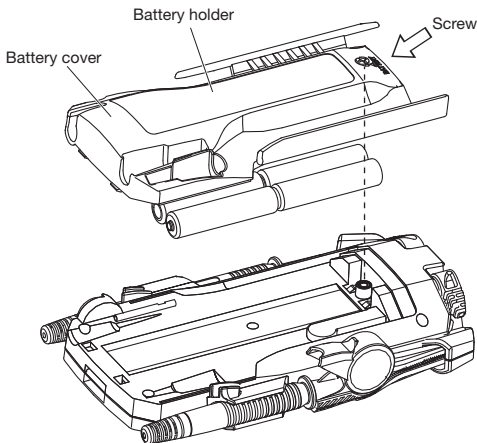

[7] AFTER-SALE SERVICE

7-1 Warranty and Provision

Sanwa offers comprehensive warranty services to its end-users and to its product resellers. Under Sanwa's general warranty policy, each instrument is warranted to be free from defects in workmanship or material under normal use for the period of one (1) year from the date of purchase.

This warranty policy is valid within the country of purchase only and applied only to the product purchased from a Sanwa authorized agent or distributor.

Sanwa reserves the right to inspect all warranty claims to determine the extent to which the warranty policy shall apply. This warranty shall not apply to disposable batteries, or any product or parts, which have been subject to one of the following causes:

1. A failure due to improper handling or use that deviates from the instruction manual.
2. A failure due to inadequate repair or modification by people other than Sanwa service personnel.
3. A failure due to causes not attributable to this product such as fire, flood, and other natural disaster.
4. Non-operation due to a discharged battery.
5. A failure or damage due to transportation, relocation, or dropping after the purchase.

7-2 Repair

Customers are asked to provide the following information when requesting services:

1. Customer name, address, and contact information
2. Description of problem
3. Description of product configuration
4. Model Number
5. Product Serial Number
6. Proof of Date-of-Purchase
7. Where you purchased the product

Please contact a Sanwa authorized agent / distributor / service provider, listed in our website, in your country with above information. An instrument sent to a Sanwa / agent / distributor without above information will be returned to the customer.

Note:

- 1) Prior to requesting repair, please check the following:
Capacity of the batteries, polarity of installation, and discontinuity of the test leads.
- 2) Repair during the warranty period:
The failed instrument will be repaired in accordance with the conditions stipulated in “7-1 Warranty and Provision”.
- 3) Repair after the warranty period has expired:
In some cases, repair and transportation cost may become higher than the price of the product. Please contact a Sanwa authorized agent / service provider in advance. The minimum retention period of service functional parts is six (6) years after the discontinuation of manufacture. This retention period is the repair warranty period. Please note, however, if such functional parts become unavailable for reasons of discontinuation of manufacture, etc., the retention period may become shorter accordingly.
- 4) Precautions when sending the product to be repaired:
To ensure the safety of the product during transportation, place the product in a box that is larger than the product 5 times or more in volume and fill cushion materials fully and then clearly mark “Repair Product Enclosed” on the box surface. The cost of sending and returning the product shall be borne by the customer.


7-3 SANWA Website

<https://www.sanwa-meter.co.jp>

E-mail: exp_sales@sanwa-meter.co.jp

[8] SPECIFICATIONS (MG601/MG601-M)

8-1 General Specifications

Operation method	Δ - Σ method
AC detection method	True RMS method
Display	Primary value 9999 (voltage, resistance, continuity check) 210 (M Ω) 1999 (frequency)
Sampling rate	Approx. 2 times/sec. (DCV)
Over-range display	Primary value section "9999" (and max. value of each M Ω measurement voltage range [blinking]) and ">" blinking
Range selection	Auto range only
Polarity switching	Automatic switching (only "-" indicated)
Low battery indication	 indicated on LCD at approx. 4.3 V to 5.0 V or less
Operating environmental condition	Altitude 2000 m or less, indoor use, environmental pollution degree II
Operating temperature/humidity	0 ~ 40 °C, 90 %RH or less (no condensation)
Accuracy guaranteed temperature/humidity range	23±5 °C, 80% RH or less (no condensation)
Storage temperature/humidity	-10 ~ 60 °C, 90 %RH or less (no condensation without batteries)
Power supply	AAA (LR03) alkaline batteries 1.5 V x 4
Auto power off	Approx. 15 min. after last operation, approx. 10 μ A
Possible measurement times	Approx. 400 times (500 V or less, rated measurement voltage x 0.001 M Ω measurement) 5 sec. ON, 25 sec. OFF
Dimensions, mass	H 147 x W 68 x D 30 mm, approx. 298 g (excluding protrusions, including batteries)
Manufacturing year	Most significant 2 digits of the serial number on the back of the instrument show the lower 2 digits of the manufacturing year (20xx).

IP Protection rating	IP30 (with measurement probe)
Safety compliances	IEC61010-1 CAT. IV 300 V CAT. III 600 V, IEC61010-031, IEC61010-2-033, IEC61010-2-034, IEC61557-1,2
EMC	IEC61326
Accessories	Instruction manual, test leads (ATL102), alligator clip (AAL301), breaker pin (ABP301), AAA (LR03) alkaline batteries x 4, connection cables (ALE101)*, carrying case (C-DG3a)*, hanger magnet (HM-1)* * Included with the MG601-M only

8-2 Optional Accessories

Hanger magnet: HM-1, carrying case: C-DG3a, AA (LR6) battery holder: BH1, connection cables: ALE101, clip adapter: AAL302 (not certified to safety standards)

8-3 Measuring Range and Accuracy

Temperature: 23 ± 5 ° C, Humidity: 80 % RH max. (no condensation), External magnetic field: None, Battery voltage: Within the effective battery range, rdg (reading): read value, dgt (digit): number of counts of last digit

AUTOV DC, AC Voltage

Range	Accuracy	Input Resistance	Remarks
600.0 V	$\pm(1.2 \% \text{rdg} + 5 \text{dgt})$	Approx. 10 M Ω	<ul style="list-style-type: none"> Measurement range DC: $\geq 0.5 \text{ V}$ or $\leq -0.5 \text{ V}$ AC: $\geq 0.5 \text{ V}$ (In case of AC) Accuracy guarantee frequency range: 45 to 400 Hz (sine wave)

DCmV DC Voltage (Speed)

Range	Accuracy	Input Resistance	Remarks
2000 mV	$\pm(0.5 \% + 11 \text{dgt})$	Approx. 10 M Ω	<ul style="list-style-type: none"> For analog input in conjunction with SE-9000(discontinued)/SE9100 speedometer

Hz : Frequency

Range	Accuracy	Remarks
1999 Hz	$\pm(0.5 \% \text{rdg} + 5 \text{dgt})$	<ul style="list-style-type: none"> Sensitivity: Approx. $\geq 0.5 \text{ Vrms}$ Accuracy guaranteed frequency range: $\geq 45 \text{ Hz}$ Measurement range: 1 Hz to 1999 Hz

Ω Resistance

Range	Accuracy	Remarks
999.9 Ω	±(1.5 %rdg + 7 dgt)	Open-circuit voltage: Approx. ≤2.0 V DC
9.999 kΩ		
99.99 kΩ		
999.9 kΩ		

•)) Continuity Check

Range	Accuracy	Remarks
999.9 Ω	±(1.5 %rdg + 7 dgt)	Open-circuit voltage: Approx. ≤2.0 V DC Buzzer activation range: Approx. ≤30 Ω

Insulation Resistance

Test voltage	Range	First effective measurement range Accuracy: ± (4.0 %rdg)	Second effective measurement range Accuracy: ± (8.0 %rdg)	Other measurement range Accuracy: ± (2.0 %rdg+6dgt)	Remarks
15 V	0.999 MΩ 9.99 MΩ 21.0 MΩ	0.200~ 11.0 MΩ	11.1~ 21.0 MΩ	0.000~ 0.199 MΩ	Over-range display at ≥21.0 MΩ*
500 V	0.999 MΩ 9.99 MΩ 99.9 MΩ 210 MΩ	0.200~ 110 MΩ	111~ 210 MΩ	0.000~ 0.199 MΩ	Over-range display at ≥210 MΩ*

* Over-range display for each test voltage

15 V: >21.0 MΩ (blinking)

500 V: >210 MΩ (blinking)

- Rated current: 1 mA (1 to 1.2 mA)
- Open-circuit voltage tolerance range: 1 to 1.25 times the rated measurement voltage
- Lowest limit resistance value to maintain rated measurement voltage: Rated measurement voltage x 0.001 MΩ
Ex.) 0.5 MΩ for 500 V

Test voltage (= rated measurement voltage) refers to the rated output voltage, which may be lower depending on the load being measured (when the load resistance is lower than the above lowest limit resistance value).

Ex.) When measuring 0.1 M Ω with a test voltage of 500 V, the actual output voltage will be 1 mA x 0.1 M Ω = 100 V.

IEC61557 compatible

Measurement	Uncertainty	Operating instrumental uncertainty
Voltage	$\pm(1.6 \%rdg + 7dgt)$	$\pm 30 \%$
Insulation resistance	$\pm(2 \%rdg)$	$\pm 30 \%$

This specification describes maximum values accepted by the standard.
* variation due to changing

“E1: Position, E2: supply voltage, E3: Temperature”

How to calculate accuracy

Ex.) Voltage measurement

Reading: 200.0 V

Range accuracy: $\pm(1.2\% rdg + 5 dgt^*)$ in the 999.9 V range

Measuring error: $\pm(200.0 V \times 1.2\% + 5 dgt) = \pm 2.9 V$

True value: 200.0 V \pm 2.9 V (from 197.1 to 202.9 V)

* 5 dgt in the 999.9 V range corresponds to 0.5 V.

The product specifications and its appearance described in this manual are subject to change without prior notice for improvement or other reasons.

MEMO

sanwa。

保証書

ご氏名

ご住所

〒□□□-□□□□

様

型名 **MG601、MG601-M**

製造No.

この製品は厳密なる品質管理を経てお届けするものです。

本保証書は所定項目をご記入の上保管していただき、アフターサービスの際ご提出ください。

※本保証書は再発行はいたしませんので大切に保管してください。

TEL

保証期間

ご購入日 年 月より3年間
(製品の確度については1年間)

三和電気計器株式会社

本社 = 東京都千代田区外神田 2-4-4・電波ビル
郵便番号 = 101-0021・電話 = 東京 (03) 3253-4871 (代)

保証規定

保証期間内に正常な使用状態のもとで、万一故障が発生した場合には無償で修理いたします。但し、保証期間内であっても下記の場合には保証の対象外とさせていただきます。本保証書は、日本国内において有効です。

記

- 取扱説明書に基づかない不適当な取扱い(保管状態を含む)または使用による故障
- 弊社以外による不当な修理や改造に起因する故障
- 天災などの不可抗力による故障や損傷、および故障や損傷の原因が本計器以外の事由による場合
- お買い上げ後の輸送、移動、落下などによる故障および損傷
- その他、弊社の責任ではないとみなされる故障

This warranty is valid only within Japan.

以上

年 月 日	修理内容をご記入ください。

※無償の認定は当社において行わせていただきます。

sanwa®

三和電気計器株式会社

本社=東京都千代田区外神田 2-4-4・電波ビル

郵便番号=101-0021・電話=東京(03)3253-4871(代)

大阪営業所=大阪市浪速区恵美須西2-7-2

郵便番号=556-0003・電話=大阪(06)6631-7361(代)

SANWA ELECTRIC INSTRUMENT CO., LTD.

Dempa Bldg, 4-4 Sotokanda 2-Chome Chiyoda-Ku, Tokyo, Japan